

Leak Report



Yenilikçi Çözüm Ortakçınız...

Project Info

Project Name: HAVA KACAK RAPORU
Customer: XXXXXXXX
Address: XXXXXXXX
54400 SAKARYA
TURKIYE
Start Date: 2022-06-22
End Date: 2022-06-28

Service Company

Name: NESKA OTOMASYON ve OLCUM
Address: Halil Rifat Pasa Mahallesi Yuzer Havuz Sokak No:1
Perpa Ticaret Merkezi A Blok Kat:11 No:1713 SISLI
34384 ISTANBUL
TURKIYE
Contact: info@neskaotomasyon.com
0212 401 06 89

Project Summary

Total Number of Leaks:	56
Total estimate losses:	534.60 l/min
Total estimate costs:	5389 EUR
Operation hour/year:	8400 Hours
Cost/1000m3:	20.00 EUR

Leak Statistics


Location Statistics

Location	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
KOMP DAIRESI	1	2.60	26
TASLAMA MAK BESLEME	1	0.20	2
TASLAMA PRES ELUMATEC	1	0.60	6
FREZE SARTLANDIRICISI	1	2.60	26
TASLAMA TEST MAK MOTOR KABINI	1	1.50	15
TASLAMA TEST UNITESI PISTON	2	5.10	51
HIDROLIK BAKIM TEKER SISIRME UNITE	1	1.90	19
HIDROLIK BAKIM TORNA ATOLYESI	1	1.40	14
DOKUM 1 HAVA TAB	1	9.00	91
SERAMIK ATOLYE HAVA TAB	1	1.70	17
HIDROLIK UNITE VALF	1	14.80	149
DOKUM HATTI 4 HAVA TAB	3	50.10	505
DOKUM HATTI 4 HAVA TAB	1	11.20	113
DK5 FILTRE ALT TAHLIYE	1	6.30	64
HADDE MARANGOZ	1	34.00	343
HADDE MARANGOZ	1	9.00	91
HADDE SARTLANDIRICI ALTI	1	9.00	91
FOLYO HADDE1 RAKOR BAKANTI	1	4.40	44
FOLYO HADDE 1	1	3.40	34
FOLYO HADDE1 HAVA HATTI	1	4.40	44

Location	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
FOLYO HADDE 1 T BAGLANTI	1	5.30	53
TAV FIRINLARI SOLENOID VALF	1	6.30	64
TAV FIRINI AKTUATOR VANA	1	2.60	26
TAV 4 SARTLANDIRICI KAVANOZ	1	2.60	26
TAV7 VALF BAGLANTI RAKORU	1	7.40	75
TAV8 SARTLANDIRICI	1	3.20	32
TAV10 AKTUATORLU VANA	1	1.60	16
TAV11 RAKOR KACAGI	1	5.30	53
TAV UST KURESEL VANA	1	4.80	48
SOGUK HADDE AKTUATORLU VANA	1	9.80	99
LEVHA PAKETLEME HAVA TAB	1	2.60	26
LEVHA PAKETLEME SARTLANDIRICI	1	1.90	19
MANUEL PAKETLEME HAVA TAB MAKARASI	1	12.60	127
HAVA TAB BAGLANTISI	1	5.30	53
HAMSU ODA YUMUSATMA SUYU ATIK HAT	1	4.80	48
HAMSU ODASI HAVA TABANCASI	1	6.80	69
FOLYO TAV FIRIN 5 POZISYONER GIRIS	1	1.10	11
FOLYO TAV FIRIN 6 POZISYONER	1	42.40	427
FOLYO TAV 10 AKTUATOR VALF	1	12.60	127
ARITMA AKTUATOR VANA	1	11.60	117

Location	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
ARITMA SARTLANDRICI CIKISI A025V03	1	2.60	26
KOAGULASYON TANKI HAVA HORTUMU	1	9.80	99
ARITMA BOLGESI KISICI VALF CIKISI	1	3.40	34
ARITMA GAZ YIKAMA KULESI ONU VALF	1	3.10	31
BOYA HATTI YIKAMA SPRING AKTUATOR	3	156.80	1581
BOYA HATTI YIKAMA SOLENOID VALF	1	6.30	64
BOYA HATTI YIKAMA REGULATOR ALTI	1	2.60	26
BOYA HATTI YIKAMA VALF	1	7.40	75
BOYA HATTI YIKAMA REG VALF	1	5.80	58
BOYA HATTI YIKAMA UST SART UNITE	1	9.20	93
BOYA HAT UST KAT SART UNITESI	1	3.80	38


Leak losses by location

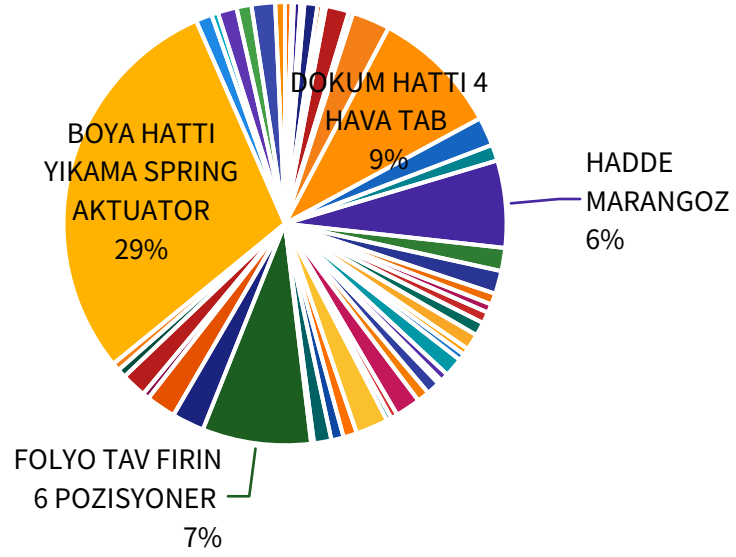

Group Statistics

Group	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
MANOMETRE	4	6.80	69
FILTRE	8	37.20	375
VALF	15	229.80	2316
KAPLIN	6	15.60	157
PISTON	1	3.90	39
HORTUM	5	70.60	712
KAPLIN	6	70.60	712
RAKOR	11	100.10	1009


Leak losses by Group

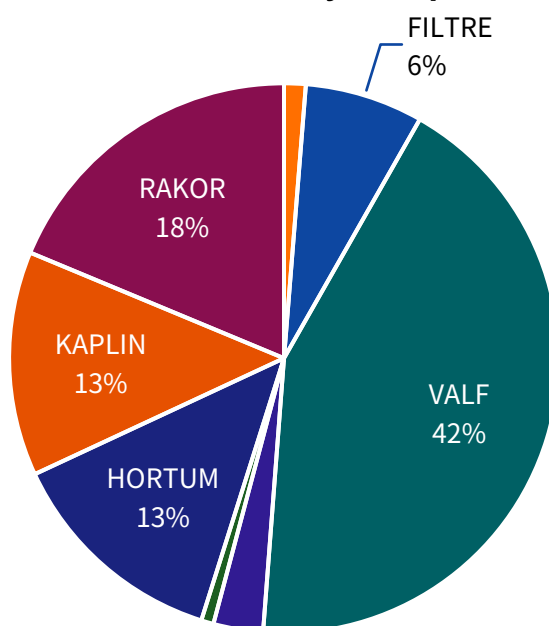


Leak Grade Statistics

Grade Level	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
Level 0	0	0.00	0
Level 1	2	0.80	8
Level 2	22	54.40	548
Level 3	14	80.60	812
Level 4	18	398.80	4020

Leak losses by Grade

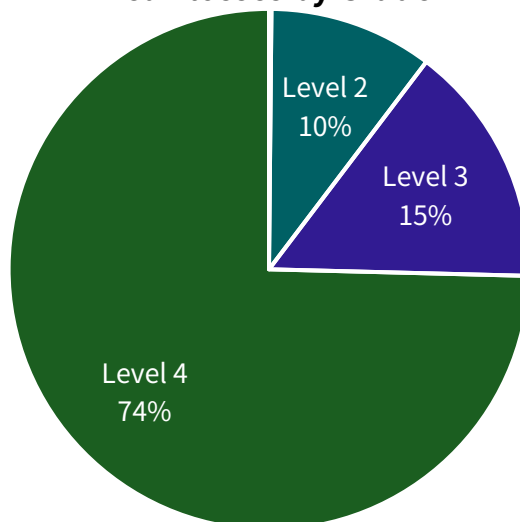


Leak numbers by Grade

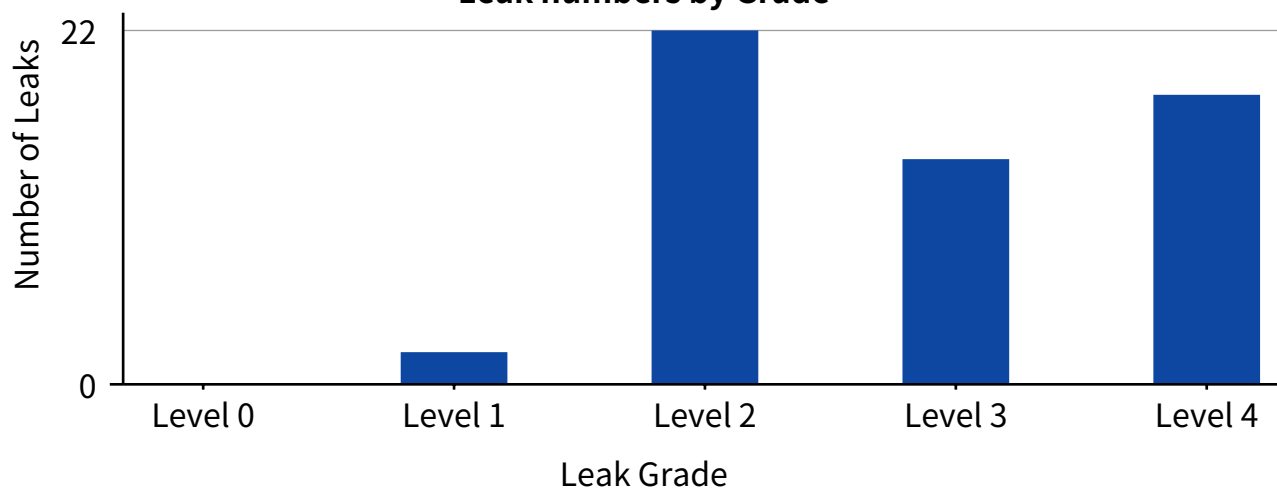

List of Leakages


Tag	Leak Info	Losses
002	Location: KOMP DAIRESI Group: MANOMETRE Grade: 2 Distance: 200 cm Recorded: 2022-06-22	2.60 l/min 26 EUR/year Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

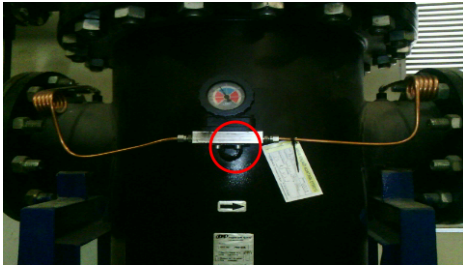

Tag	Leak Info	Losses
003	Location: TASLAMA MAK BESLEME Group: MANOMETRE Grade: 1 Distance: 100 cm Recorded: 2022-06-22	0.20 l/min 2 EUR/year Sound Level: 43 dB Pressure: 5.00 bar Last updated: 2022-06-28

Notes: SART GIRISI KONTROL

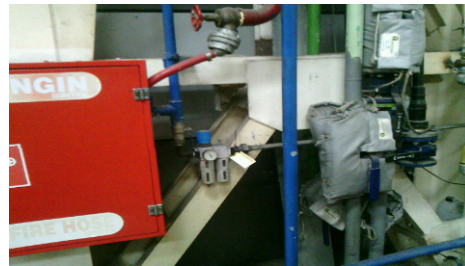

Tag	Leak Info	Losses
004	Location: TASLAMA PRES ELUMATEC Group: MANOMETRE Grade: 1 Distance: 200 cm Recorded: 2022-06-22	0.60 l/min 6 EUR/year
	Sound Level: 44 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: FR ICIN KONTROL




Tag	Leak Info	Losses
006	Location: FREZE SARTLANDIRICISI Group: FILTRE Grade: 2 Distance: 200 cm Recorded: 2022-06-22	2.60 l/min 26 EUR/year
	Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: SARTLANDIRICI KONTROL VE DEGISIM




Tag	Leak Info	Losses
007	Location: TASLAMA TEST MAK MOTOR KABINI Group: VALF Grade: 2 Distance: 200 cm Recorded: 2022-06-22	1.50 l/min 15 EUR/year Sound Level: 51 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: SOLENOID VALF KONTROL VE DEGISIM

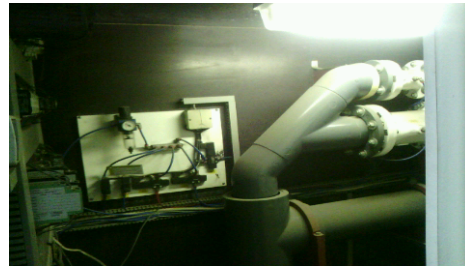

Tag	Leak Info	Losses
008	Location: TASLAMA TEST UNİTESİ PİSTON Group: KAPLIN Grade: 2 Distance: 200 cm Recorded: 2022-06-22	1.20 l/min 12 EUR/year Sound Level: 49 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: PİSTON İCİN KONTROL VE DEĞİŞİM

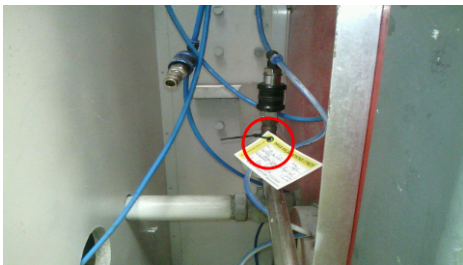


Tag	Leak Info	Losses
009	Location: TASLAMA TEST UNITESI PISTON Group: PISTON Grade: 2 Distance: 200 cm Recorded: 2022-06-22	3.90 l/min 39 EUR/year
	Sound Level: 52 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: PISTONLAR ICIN KONTROL VE DEGISIM



Tag	Leak Info	Losses
010	Location: HIDROLIK BAKIM TEKER SISIRME UNITE Group: KAPLIN Grade: 2 Distance: 200 cm Recorded: 2022-06-22	1.90 l/min 19 EUR/year
	Sound Level: 53 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KAPLIN BAGLANTI KONTROL VE DEGISIM

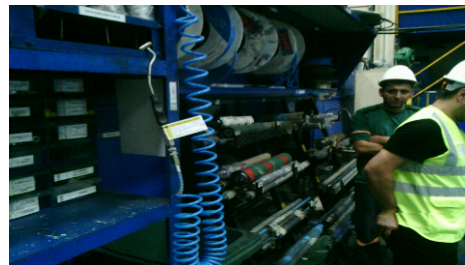

Tag	Leak Info	Losses
011	Location: HIDROLIK BAKIM TORNA ATOLYESI Group: KAPLIN Grade: 2 Distance: 200 cm Recorded: 2022-06-22	1.40 l/min 14 EUR/year Sound Level: 50 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: FREZE TEZGAH HAVA TAB DEGISIM




Tag	Leak Info	Losses
012	Location: DOKUM 1 HAVA TAB Group: HORTUM Grade: 4 Distance: 200 cm Recorded: 2022-06-22	9.00 l/min 91 EUR/year Sound Level: 69 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: HAVA TAB KONTROL VE DEGISIM



Tag	Leak Info	Losses
013	Location: SERAMİK ATOLYE HAVA TAB Group: KAPLIN Grade: 2 Distance: 200 cm Recorded: 2022-06-22	1.70 l/min 17 EUR/year Sound Level: 52 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: HAVA TAB KONTROL VE DEĞİŞİM

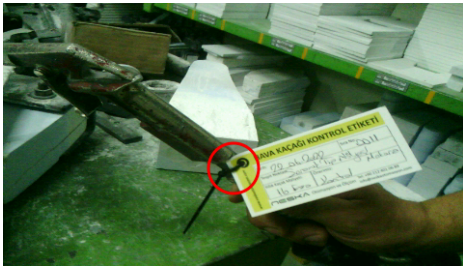

Tag	Leak Info	Losses
014	Location: HIDROLİK UNITE VALF Group: VALF Grade: 4 Distance: 200 cm Recorded: 2022-06-22	14.80 l/min 149 EUR/year Sound Level: 75 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: VALF İÇİN KONTROL VE DEĞİŞİM




Tag	Leak Info	Losses
015	Location: DOKUM HATTI 4 HAVA TAB Group: KAPLIN Grade: 2 Distance: 200 cm Recorded: 2022-06-22	3.10 l/min 31 EUR/year Sound Level: 58 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGISIM



Tag	Leak Info	Losses
016	Location: DOKUM HATTI 4 HAVA TAB Group: HORTUM Grade: 4 Distance: 200 cm Recorded: 2022-06-22	31.00 l/min 312 EUR/year Sound Level: 83 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: HORTUM DEGISIMI ONERILIR

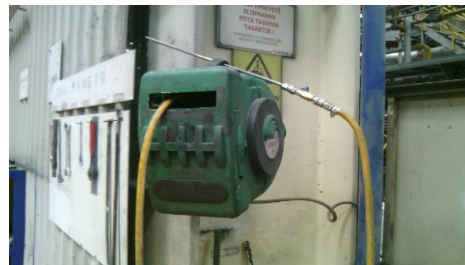

Tag	Leak Info	Losses
017	Location: DOKUM HATTI 4 HAVA TAB Group: HORTUM Grade: 4 Distance: 200 cm Recorded: 2022-06-22	16.00 l/min 161 EUR/year Sound Level: 76 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: HORTUM DEGISIMI ONERILIR





Tag	Leak Info	Losses
019	Location: DOKUM HATTI 4 HAVA TAB Group: KAPLIN Grade: 4 Distance: 200 cm Recorded: 2022-06-22	11.20 l/min 113 EUR/year Sound Level: 62 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGISIM



Tag	Leak Info	Losses
020	Location: DK5 FILTRE ALT TAHLIYE Group: FILTRE Grade: 3 Distance: 200 cm Recorded: 2022-06-22	6.30 l/min 64 EUR/year
	Sound Level: 66 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: DEGISIM ONERILIR

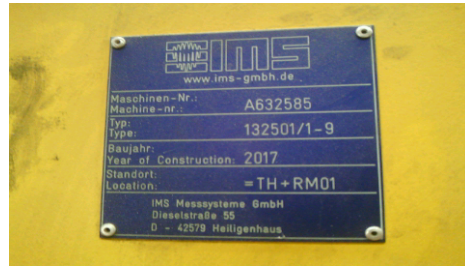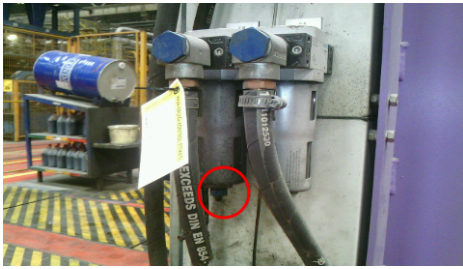

Tag	Leak Info	Losses
021	Location: HADDE MARANGOZ Group: KAPLIN Grade: 4 Distance: 200 cm Recorded: 2022-06-22	34.00 l/min 343 EUR/year
	Sound Level: 74 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEGISIM



Tag	Leak Info	Losses
023	Location: HADDE MARANGOZ Group: FILTRE Grade: 4 Distance: 200 cm Recorded: 2022-06-22	9.00 l/min 91 EUR/year
	Sound Level: 69 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: DEGİSİM ONERİLİR



Tag	Leak Info	Losses
024	Location: HADDE SARTLANDIRICI ALTI Group: FILTRE Grade: 4 Distance: 200 cm Recorded: 2022-06-22	9.00 l/min 91 EUR/year
	Sound Level: 69 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: DEGİSİM ONERİLİR



Tag	Leak Info	Losses
025	Location: FOLYO HADDE1 RAKOR BAĞLANTI Group: RAKOR Grade: 3 Distance: 200 cm Recorded: 2022-06-22	4.40 l/min 44 EUR/year
	Sound Level: 62 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: İLGİLİ URUNLER ICIN DEGISIM ONERILIR



Tag	Leak Info	Losses
026	Location: FOLYO HADDE 1 Group: MANOMETRE Grade: 2 Distance: 200 cm Recorded: 2022-06-22	3.40 l/min 34 EUR/year
	Sound Level: 59 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEGISIM ONERILIR



Tag	Leak Info	Losses
027	Location: FOLYO HADDE1 HAVA HATTI Group: KAPLIN Grade: 3 Distance: 200 cm Recorded: 2022-06-22	4.40 l/min 44 EUR/year Sound Level: 62 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: DEGİSİM ONERİLİR




Tag	Leak Info	Losses
028	Location: FOLYO HADDE 1 T BAGLANTI Group: RAKOR Grade: 3 Distance: 200 cm Recorded: 2022-06-22	5.30 l/min 53 EUR/year Sound Level: 64 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEĞİSİM ONERİLİR




Tag	Leak Info	Losses
029	Location: TAV FIRINLARI SOLENOID VALF Group: VALF Grade: 3 Distance: 200 cm Recorded: 2022-06-23	6.30 l/min 64 EUR/year Sound Level: 66 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

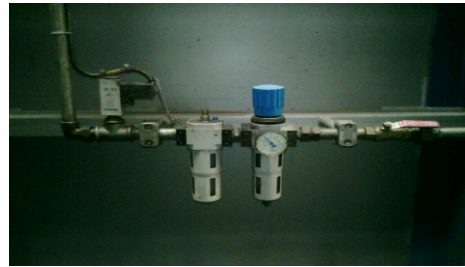


Tag	Leak Info	Losses
030	Location: TAV FIRINI AKTUATOR VANA Group: RAKOR Grade: 2 Distance: 200 cm Recorded: 2022-06-23	2.60 l/min 26 EUR/year Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

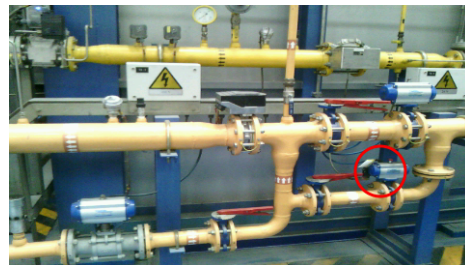


Tag	Leak Info	Losses
031	Location: TAV 4 SARTLANDIRICI KAVANOZ Group: FILTRE Grade: 2 Distance: 200 cm Recorded: 2022-06-23	2.60 l/min 26 EUR/year Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: ~~S~~ARTLANDIRICI DE~~S~~İM

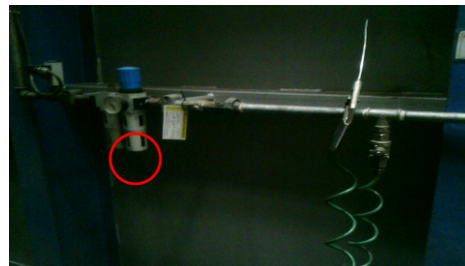


Tag	Leak Info	Losses
032	Location: TAV7 VALF BAGLANTI RAKORU Group: RAKOR Grade: 3 Distance: 200 cm Recorded: 2022-06-23	7.40 l/min 75 EUR/year Sound Level: 68 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: AKTUATOR VANA CIN KONTROL VE DEGİSİM

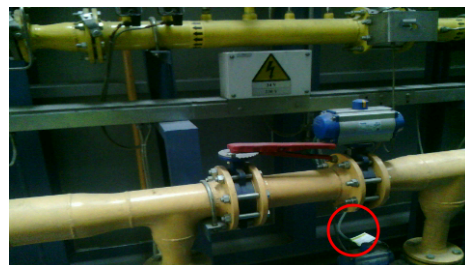

Tag	Leak Info	Losses
033	Location: TAV8 SARTLANDIRICI Group: FİLTRE Grade: 2 Distance: 300 cm Recorded: 2022-06-23	3.20 l/min 32 EUR/year
	Sound Level: 54 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEĞİŞİM ÖNERİLİR

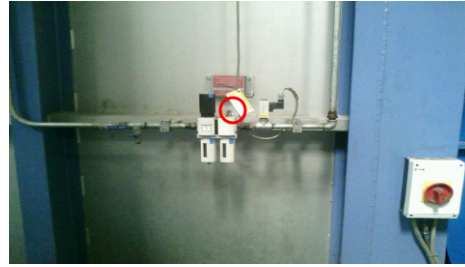

Tag	Leak Info	Losses
035	Location: TAV10 AKTUATORLU VANA Group: VALF Grade: 2 Distance: 300 cm Recorded: 2022-06-23	1.60 l/min 16 EUR/year
	Sound Level: 47 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEĞİŞİM ÖNERİLİR



Tag	Leak Info	Losses
036	Location: TAV11 RAKOR KACAGI Group: RAKOR Grade: 3 Distance: 200 cm Recorded: 2022-06-23	5.30 l/min 53 EUR/year
	Sound Level: 64 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEGİSİM ONERİLİR



Tag	Leak Info	Losses
037	Location: TAV UST KURESEL VANA Group: HORTUM Grade: 3 Distance: 200 cm Recorded: 2022-06-23	4.80 l/min 48 EUR/year
	Sound Level: 63 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEGİSİM ONERİLİR



Tag	Leak Info	Losses
038	Location: SOGUK HADDE AKTUATORLU VANA Group: VALF Grade: 4 Distance: 200 cm Recorded: 2022-06-23	9.80 l/min 99 EUR/year Sound Level: 70 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: FILTRE ODASI VALF KONTROL VE DEGISIM




Tag	Leak Info	Losses
039	Location: LEVHA PAKETLEME HAVA TAB Group: KAPLIN Grade: 2 Distance: 200 cm Recorded: 2022-06-23	2.60 l/min 26 EUR/year Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGISIM ONERILIR




Tag	Leak Info	Losses
040	Location: LEVHA PAKETLEME SARTLANDIRICI Group: FILTRE Grade: 2 Distance: 200 cm Recorded: 2022-06-23	1.90 l/min 19 EUR/year Sound Level: 53 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: FILTRE REGULATOR DEGISIM

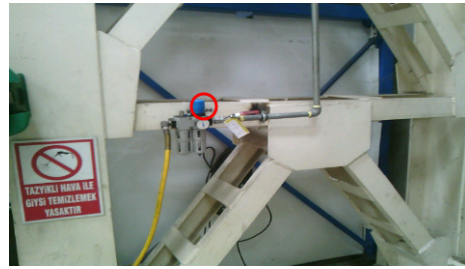



Tag	Leak Info	Losses
041	Location: MANUEL PAKETLEME HAVA TAB MAKARASI Group: KAPLIN Grade: 4 Distance: 200 cm Recorded: 2022-06-23	12.60 l/min 127 EUR/year Sound Level: 73 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGISIM ONERILIR

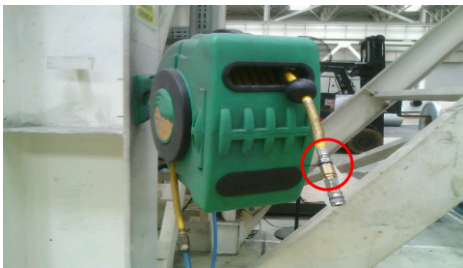

Tag	Leak Info	Losses
042	Location: HAVA TAB BAGLANTISI Group: KAPLIN Grade: 3 Distance: 200 cm Recorded: 2022-06-23	5.30 l/min 53 EUR/year Sound Level: 64 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

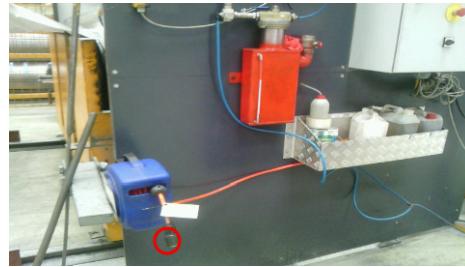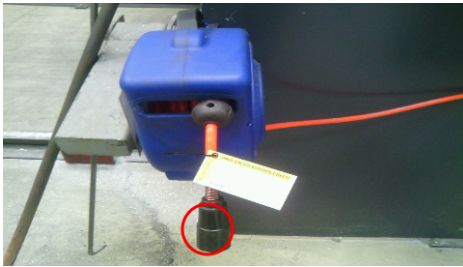

Tag	Leak Info	Losses
043	Location: HAMSU ODA YUMUSATMA SUYU ATIK HAT Group: RAKOR Grade: 3 Distance: 200 cm Recorded: 2022-06-23	4.80 l/min 48 EUR/year Sound Level: 63 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR



Tag	Leak Info	Losses
044	Location: HAMSU ODASI HAVA TABANCASI Group: KAPLIN Grade: 3 Distance: 200 cm Recorded: 2022-06-23	6.80 l/min 69 EUR/year Sound Level: 67 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR



Tag	Leak Info	Losses
045	Location: FOLYO TAV FIRIN 5 POZİSYONER GİRİS Group: RAKOR Grade: 2 Distance: 200 cm Recorded: 2022-06-23	1.10 l/min 11 EUR/year Sound Level: 48 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR



Tag	Leak Info	Losses
046	Location: FOLYO TAV FIRIN 6 POZISYONER Group: RAKOR Grade: 4 Distance: 200 cm Recorded: 2022-06-23	42.40 l/min 427 EUR/year Sound Level: 87 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR





Tag	Leak Info	Losses
047	Location: FOLYO TAV 10 AKTUATOR VALF Group: RAKOR Grade: 4 Distance: 200 cm Recorded: 2022-06-23	12.60 l/min 127 EUR/year Sound Level: 73 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR




Tag	Leak Info	Losses
048	Location: ARITMA AKTUATOR VANA Group: RAKOR Grade: 4 Distance: 200 cm Recorded: 2022-06-23	11.60 l/min 117 EUR/year Sound Level: 72 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

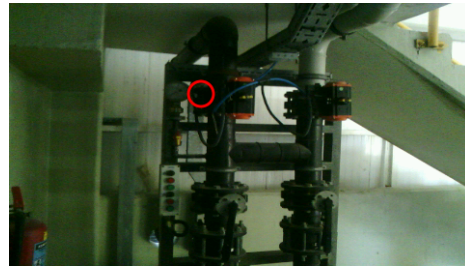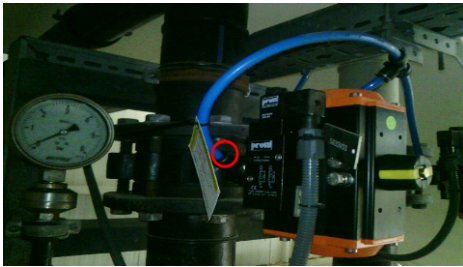

Tag	Leak Info	Losses
049	Location: ARITMA SARTLANDRICI ÇIKIŞI A025V03 Group: RAKOR Grade: 2 Distance: 200 cm Recorded: 2022-06-23	2.60 l/min 26 EUR/year Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

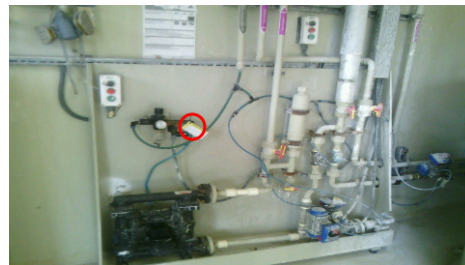

Tag	Leak Info	Losses
050	Location: KOAGULASYON TANKI HAVA HORTUMU Group: HORTUM Grade: 4 Distance: 200 cm Recorded: 2022-06-23	9.80 l/min 99 EUR/year Sound Level: 70 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR




Tag	Leak Info	Losses
052	Location: ARITMA BOLGESI KISICI VALF ÇIKISI Group: VALF Grade: 2 Distance: 200 cm Recorded: 2022-06-23	3.40 l/min 34 EUR/year Sound Level: 59 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR




Tag	Leak Info	Losses
053	Location: ARITMA GAZ YIKAMA KULESI ONU VALF Group: VALF Grade: 2 Distance: 200 cm Recorded: 2022-06-23	3.10 l/min 31 EUR/year Sound Level: 58 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

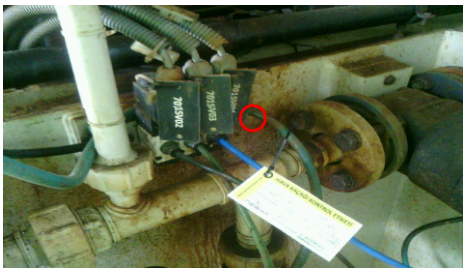

Tag	Leak Info	Losses
054	Location: BOYA HATTI YIKAMA SPRING AKTUATOR Group: VALF Grade: 4 Distance: 200 cm Recorded: 2022-06-24	53.60 l/min 540 EUR/year Sound Level: 90 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: DEGİSİM ONERİLİR

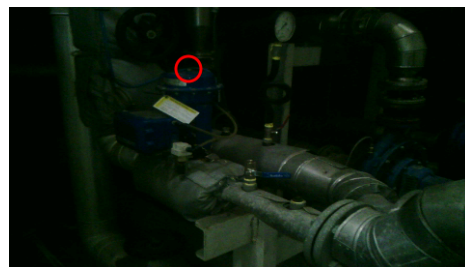


Tag	Leak Info	Losses
055	Location: BOYA HATTI YIKAMA SPRING AKTUATOR Group: VALF Grade: 4 Distance: 200 cm Recorded: 2022-06-24	49.60 l/min 500 EUR/year Sound Level: 89 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: AYNI VALFIN IKINCI KACAGI





Tag	Leak Info	Losses
056	Location: BOYA HATTI YIKAMA SPRING AKTUATOR Group: VALF Grade: 4 Distance: 200 cm Recorded: 2022-06-24	53.60 l/min 540 EUR/year Sound Level: 90 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

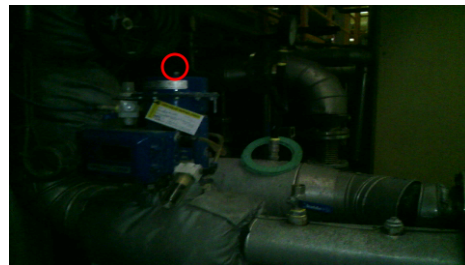

Tag	Leak Info	Losses
057	Location: BOYA HATTI YIKAMA SOLENOID VALF Group: VALF Grade: 3 Distance: 200 cm Recorded: 2022-06-24	6.30 l/min 64 EUR/year Sound Level: 66 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR

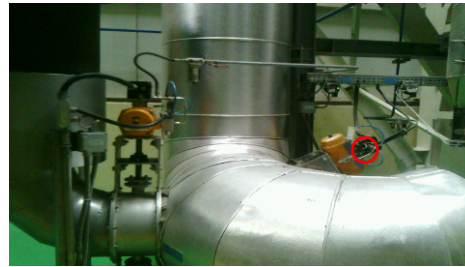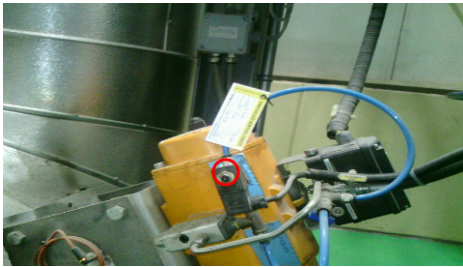



Tag	Leak Info	Losses
058	Location: BOYA HATTI YIKAMA REGULATOR ALTI Group: FİLTRE Grade: 2 Distance: 200 cm Recorded: 2022-06-24	2.60 l/min 26 EUR/year Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGİSİM ONERİLİR




Tag	Leak Info	Losses
060	Location: BOYA HATTI YIKAMA VALF Group: VALF Grade: 3 Distance: 200 cm Recorded: 2022-06-24	7.40 l/min 75 EUR/year
	Sound Level: 68 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEGİSİM ONERİLİR

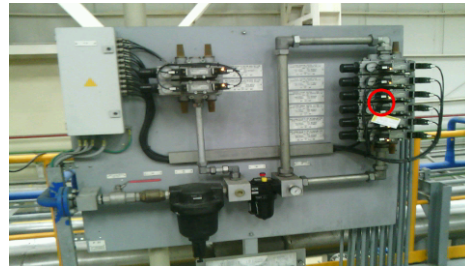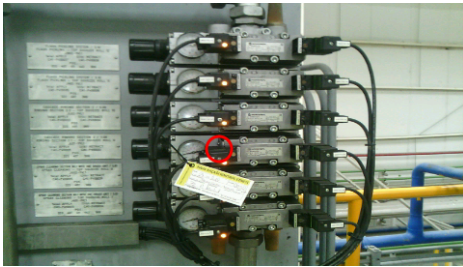



Tag	Leak Info	Losses
061	Location: BOYA HATTI YIKAMA REG VALF Group: VALF Grade: 3 Distance: 200 cm Recorded: 2022-06-24	5.80 l/min 58 EUR/year
	Sound Level: 56 dB Pressure: 7.00 bar Last updated: 2022-06-28	

Notes: KONTROL VE DEGİSİM ONERİLİR

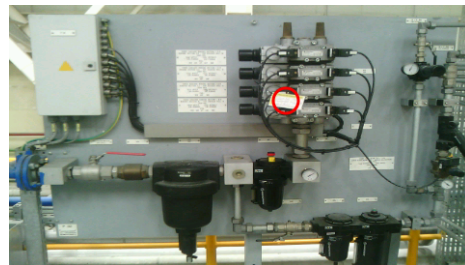


Tag	Leak Info	Losses
062	Location: BOYA HATTI YIKAMA UST SART UNITE Group: VALF Grade: 4 Distance: 200 cm Recorded: 2022-06-24	9.20 l/min 93 EUR/year Sound Level: 69 dB Pressure: 6.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGISIM ONERILIR

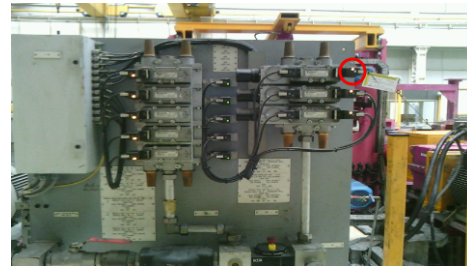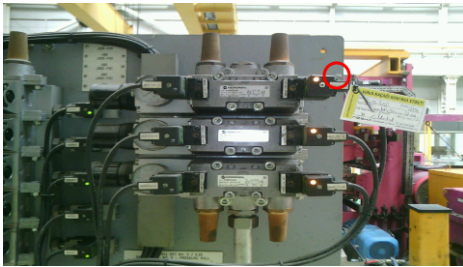

Tag	Leak Info	Losses
063	Location: BOYA HAT UST KAT SART UNITESI Group: VALF Grade: 2 Distance: 200 cm Recorded: 2022-06-24	3.80 l/min 38 EUR/year Sound Level: 60 dB Pressure: 6.00 bar Last updated: 2022-06-28

Notes: KONTROL VE DEGISIM ONERILIR

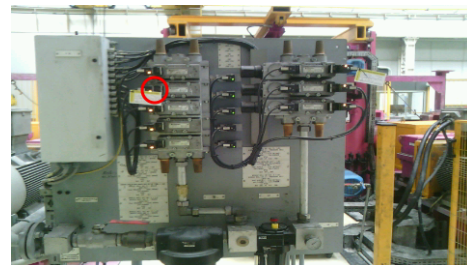

Notes/Additional Info
